Tax Map ID#057.-01-28.0

NOTICE OF HEARING

PLEASE TAKE NOTICE that pursuant to Section 148-4, 148-5 148-6 148-7 148-8 and 148-10 of the Zoning Law of the Town of Skaneateles 2020 and Section 274-a and 274-b Town Law of the State of New York, the Planning Board of the Town of Skaneateles will hold a Public Hearing on the application of John and Mandy Scott for a Special Permit/Site Plan Review.

The application is to rebuild the existing boathouse and retaining wall, and rebuild shoreline stairs.

The property in question is located at 1423 Thornton Heights Road in the Town of Skaneateles, New York and bears Tax Map ID#057.-01-28.0

A copy of the application is available for inspection at the Town Hall, 24 Jordan Street, Skaneateles, New York.

SAID HEARING will be held on *Tuesday January 21, 2025 at 6:50 p.m.* at the Town Offices, 24 Jordan Street, Skaneateles, New York or electronically as required by local and/or Executive Orders applicable to COVID 19. At that time all people will be heard or have an opportunity to provide written comment on this application.

Donald Kasper, Chair Planning Board -Town of Skaneateles Dated: January 8, 2025 EGGLESTON & KRENZER ARCHITECTS, PC

The Trolley Bldg 1391 East Genesee Street Skaneateles, New York 13152

December 5, 2024

Town of Skaneateles Planning Board and ZBA 24 Jordan Street Skaneateles, NY 13152

Re: John and Mandy Scott Site Plan Review 1423 Thornton Heights Tax ID# 057.-01-28

NARRATIVE

The existing property has 8,522 SF lot size, 50 FT wide and 58 LF of shoreline in the RF District and Skaneateles Lake watershed. A two bedroom seasonal cottage, boat house, lake patio, stairs and walkway are on the lot. The lot has a steep slope at the lake where the stairs are unsafe and not code compliant. The bank is collapsing against the back of the boathouse. The gravel patio behind the seawall washes out every winter. A variance and special permit were granted for the property in 2013 when the cottage was redeveloped. A new septic system was place at the west end of the property in 2014. The ISC is 14.6% and TSC is 24.4%. There are 882 SF of on-shore lakefront structures.

This application is to replace the shore line stairs with code compliant stairs in the same location and rebuild the boat house with a concrete west wall that will serve as a retaining wall against the steep bank. Limestone boulders will be placed at the bottom of the bank to help provide erosion control. This retaining wall will be behind the lake line. The patio behind the seawall will receive deck boards to prevent the wave action from washing it out every winter. The ISC will remain at 14.6%, TSC at 24.4% and the on-shore structures will reduce to 880 SF.


The new stairs will be supported by posts set in the steep slope and with the shallower pitch of the stairs more space under the stairs will allow for better vegetative ground cover. Much of the work will be performed from a barge with minimal disturbance placing the limestone boulders at the base of the steep slope. Silt fence will be placed below the work area.

During the 2013 Special Permit application, the lot was 8,644 SF before erosion at the lake front reduced the lot size 122 SF. A special permit was granted for 13.7% (1,180 SF) ISC. The lot currently has 69 SF additional ISC surface coverage due to an 18 SF concrete landing and stone steps that are larger than 3 ft wide. 69 SF of additional coverage would require 690 SF of land to correct this overage. At \$1.09/SF, a payment of \$752.10 can be made to the Town's LDRA Fund if necessary.

(315) 685-8144

CONSTRUCTION SEQUENCE

- 1) Place silt fence and maintain during construction.
- 2) Mark and protect septic area from construction traffic and staging.
- 3) Remove existing boathouse structure.
- 4) Make alterations to the cottage, add posts for new porch and frame porch.
- 5) Excavate, form and place concrete for new boathouse foundation and retaining wall. Concrete will be pumped from Thornton Heights Road.
- 6) Place Limestone boulders at base of steep bank with filter fabric stone behind.
- 7) Construct new stairs and patio decking.
- 8) Spread topsoil over disturbed areas, plant ground cover and mulch. Water during dry periods.
- 9) After site is stabilized, remove silt fence.

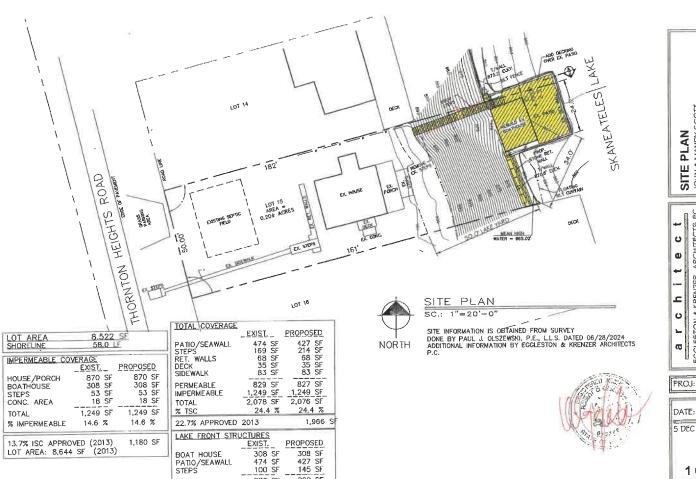

880 SF

TOTAL


JOHN & MANDY SCOTT 1423 THORNTON HEIGHTS RD. TN. OF SKANEATELES, NY


EGGLESTON ¢ KRENZER, ARCHITECTS PC 1391 EAST GENESEE STREET SKANEATELES, NY 13152 (315) G85-8144

PROJ: 24141

5 DEC 2024

1 OF 4

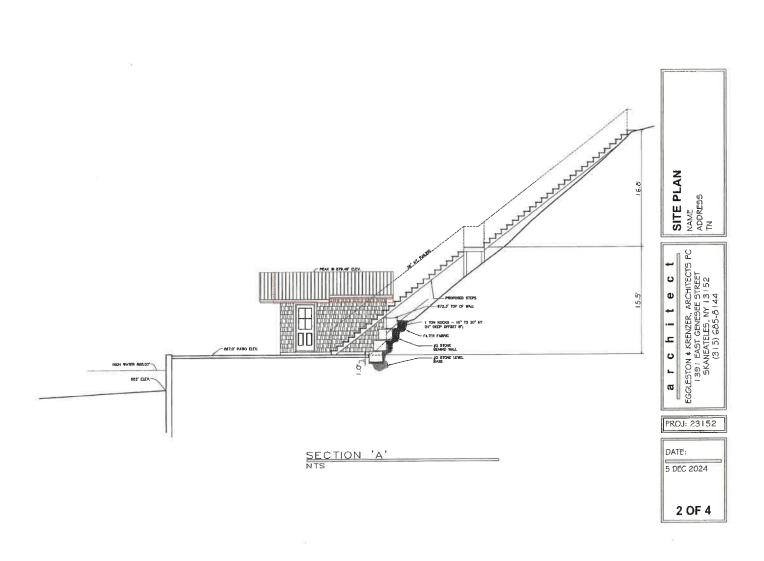

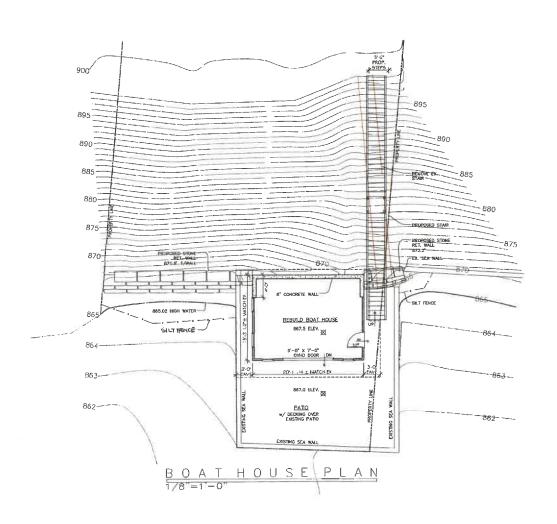

REBUILD BOATHOUSE JOHN & MANDY SCOTT 1423 THORNTON HEIGHTS RD. TN. OF SKANEATELES, NY

EGGLESTON & KRENZER, ARCHITECTS PC 1391 EAST GENESEE STREET SKANEATELES, NY 13152 (315) 685-8144 ပ ---c h a -

PROJ: 24141

DATE: 5 DEC 2024

3 OF 4

